KIRAY 200
Infrared thermometer
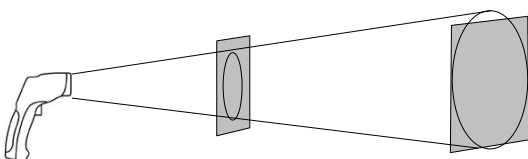
New

CE
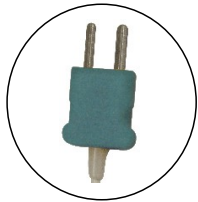
Supplied with thermocouple K probe

Infrared thermometer **KIRAY 200** is an infrared thermometer used to diagnose, inspect and check any temperature. Thanks to its elaborated optical system, it allows an easy and accurate measurement of little distant targets. **KIRAY 200** instrument has an internal memory which can save up to 20 measurements.

■ Technical features

• Instrument features

Spectral response	8 -14 µm
Optical	D.S : 30:1 (50 mm at 1500 mm)
Response time	Less than 1 second
Temperature range	From -50 to +850°C
Accuracy*	From -50 to -20°C : ±5°C
	From -20 to +200°C : ±1.5% of reading ±2°C
	From +200 to +538 °C : ±2% of reading ±2°C
	From +538 to +850°C : ±3.5% of reading ±5°C
Display resolution	0.1 C°
Emissivity	Adjustable from 0.10 to 1.00 (pre-set at 0.95)
Over range indication	Display indication : « -0L » for a negative over range, « 0L » for a positive over range.
Laser sighting	Wavelength : 630-670 nm Output < 1mW, Class 2 (II)
Positive or negative temperature indication	Automatic (no indication for a positive temperature) (-) sign for a negative temperature
Display	4 ½ digits with LCD backlighted display
Auto-extinction	Automatic after 7 seconds of inactivity
High/low alarm	Flashing signal on display and beep signal with adjustable thresholds
Power supply	Alkaline 9V battery
Autonomy	38 h (inactive laser and backlight) 15 h (active laser and backlight)
Use temperature	From 0 to +50°C
Storage temperature	From -20°C to +60°C
Relative humidity	From 10% to 90%RH in operating mode and >80%RH in storage
Dimensions	175 x 110 x 45 mm
Weight	230 g (included battery)
Memory	20 temperature values with unit of measurement (°C or °F)

*Accuracy for an ambient temperature from 18 to 28°C (with a relative humidity lower than 80% RH)

■ Distance from the target

Distance	150	300	900	mm
Diameter	5	10	30	mm

D:S=30:1
50 mm at 1500 mm

YES　　　**NO**

Make sure that the target is larger than the size of the laser sighting.

• Thermocouple K probe features

Temperature range	From -40 to +400°C
Display range	From -50 to +1370°C
Resolution	0.1°C
Accuracy	±1.5% of reading ±3°C
Cable length	1 m

■ *Display*
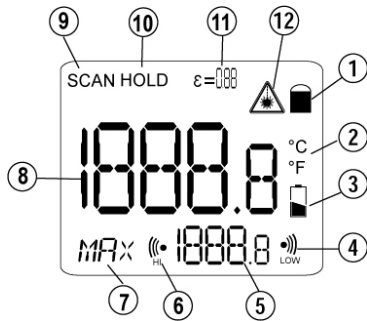
1 – Continuous measurement indicator
2 – Technical unit (°C / °F)
3 – Low battery indicator
4 – Low alarm symbol
5 – MAX, MIN, DIF (difference between MAX and MIN values), AVG (average),
   HAL (high alarm), LAL (low alarm), TK (TK temperature)
   and LOG (recorded value)
6 – High alarm symbol
7 – EMS, MAX, MIN, DIF, AVG, HAL, LAL, TK and LOG indicator
8 – Temperature value
9 – Current measurement indicator
10 – HOLD indicator (fixed measurement)
11 – Emissivity value
12 – Laser in operation indicator

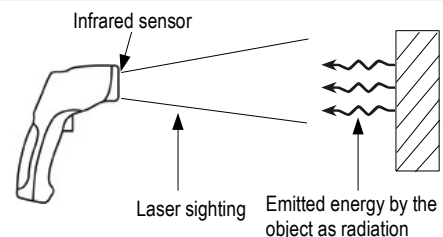## ■ *KIRAY 200 buttons*

1 – Up button. It allows to increment emissivity and high/low alarm thresholds
   and to move to the next recorded value.

2 – Set button. It allows to activate or deactivate laser and display backlight. It
   allows also to record a temperature.

3 – Mode button. It allows to navigate through the modes (emissivity, max
   value, min value, difference, average, high alarm, low alarm, TK value and
   recorded values).

4 – Down button. It allows to decrement emissivity and high/low alarm
   thresholds and to move to the previous recorded value.

■ *Description*

LCD backlighted display

Up button

Laser and backlight button

Mode button

Down button

Laser sighting output

IR sensor (infrared)

Trigger

Compartment battery

Set technical Unit (°C/°F)

Set continuous measurement (On/Off)

Set alarm (On/Off)

Input external probe

■ *Supplied with*

• Case with passer-by belt
• User manual
• K thermocouple probe

■ *CE Certification*

CE

This device meets with following standards' requirements.

• EN 50081-1 : 1992, Electromagnetic compatibility, Part 1
• EN 50082-1 : 1992, Electromagnetic compatibility, Part 2

Infrared thermometer, how it work ?

Infrared thermometers can measure the surface temperature of an object. Its optic lens catches the energy emitted and reflected by the object. This energy is collected and focused onto a detector. This information is displayed as temperature. The laser pointer is only used to aim at the target.

Infrared sensor

Laser sighting

Emitted energy by the object as radiation

www.kimo.fr

EXPORT DEPARTMENT
Tel : + 33. 1. 60. 06. 69. 25 - Fax : + 33. 1. 60. 06. 69. 29
e-mail : export@kimo.fr

AFAQ ISO 9001 VERSION 2000

Distributed by :

techniCAL
eXpanding possibilities
866-327-8731
www.techniCAL-sys.com